



[4910-13-P]

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2013-0470; Directorate Identifier 2013-SW-008-AD;

Amendment 39-17465; AD 2013-11-05]

RIN 2120-AA64

Airworthiness Directives; Bell Helicopter Textron, Inc. (Bell) Helicopters

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule; request for comments.

SUMMARY: We are adopting a new airworthiness directive (AD) for Bell Model 214B, 214B-1, and 214ST helicopters with a certain tail rotor hanger bearing (bearing) installed. This AD requires inspecting the bearing to determine whether an incorrectly manufactured seal material is installed on the bearing. This AD is prompted by a report that certain bearings were manufactured with an incorrect seal material that does not meet Bell specifications. The actions specified by this AD are intended to prevent loss of bearing grease, failure of the bearing, and subsequent loss of control of the helicopter.

DATES: This AD becomes effective [INSERT DATE 15 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

The Director of the Federal Register approved the incorporation by reference of certain documents listed in this AD as of [INSERT DATE 15 days AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

We must receive comments on this AD by [INSERT DATE 60 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

ADDRESSES: You may send comments by any of the following methods:

- Federal eRulemaking Docket: Go to <http://www.regulations.gov>. Follow the online instructions for sending your comments electronically.
- Fax: 202-493-2251.
- Mail: Send comments to the U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590-0001.
- Hand Delivery: Deliver to the “Mail” address between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> or in person at the Docket Operations Office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the economic evaluation, any comments received, and other information. The street address for the Docket Operations Office (telephone 800-647-5527) is in the ADDRESSES section. Comments will be available in the AD docket shortly after receipt.

For service information identified in this AD, contact Bell Helicopter Textron, Inc., P.O. Box 482, Fort Worth, TX 76101; telephone (817) 280-3391; fax (817) 280-6466; or at <http://www.bellcustomer.com/files/>. You may review the referenced service information at the FAA, Office of the Regional Counsel, Southwest Region, 2601 Meacham Blvd., Room 663, Fort Worth, Texas 76137.

FOR FURTHER INFORMATION CONTACT: James Blyn, Aviation Safety Engineer, Rotorcraft Certification Office, Rotorcraft Directorate, FAA, 2601 Meacham Blvd., Fort Worth, Texas 76137; telephone (817) 222-5762; email 7-AVS-ASW-170@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

This AD is a final rule that involves requirements affecting flight safety, and we did not provide you with notice and an opportunity to provide your comments prior to it becoming effective. However, we invite you to participate in this rulemaking by submitting written comments, data, or views. We also invite comments relating to the economic, environmental, energy, or federalism impacts that resulted from adopting this AD. The most helpful comments reference a specific portion of the AD, explain the reason for any recommended change, and include supporting data. To ensure the docket does not contain duplicate comments, commenters should send only one copy of written comments, or if comments are filed electronically, commenters should submit them only one time. We will file in the docket all comments that we receive, as well as a report summarizing each substantive public contact with FAA personnel concerning this rulemaking during the comment period. We will consider all the comments we receive and may conduct additional rulemaking based on those comments.

Discussion

We are adopting a new AD for Bell Model 214B, 214B-1, and 214ST helicopters with certain bearings installed. Bell was notified by a supplier that all part number 214-040-606-005 and 214-040-606-101 bearings delivered between May 2011 and June 2012

were manufactured with incorrect seal material. The incorrect seal material does not meet Bell's operating and environmental temperature specifications and under extreme heat could result in seal failure and grease loss from the bearing. The incorrect seal material is black in color; the correctly manufactured bearings have a red/orange to brown colored seal.

FAA's Determination

We are issuing this AD because we evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other helicopters of these same type designs.

Related Service Information

Bell has issued Alert Service Bulletin (ASB) 214-13-74, Revision A, dated March 25, 2013, for Model 214B and 214B-1 helicopters, serial number (S/N) 28001 through 28070, and ASB 214ST-13-90, Revision A, dated March 25, 2013, for Model 214ST helicopters, S/N 28101 through 28200. Both ASBs describe procedures for determining whether any bearing with incorrect seal material is installed on the helicopter and for inspecting any installed bearing with incorrect seal material every 10 hours time-in-service (TIS). Both ASBs also specify replacing any bearing with incorrect seal material that is leaking grease or damaged. Finally, the ASBs specify replacing any bearing with incorrect seal material within 500 hours TIS or by December 31, 2013.

AD Requirements

This AD requires:

- Inspecting each bearing within 10 hours TIS to determine whether the bearing has correct seal material.

- If a bearing has incorrect seal material, inspecting the bearing at intervals not to exceed 10 hours TIS for leakage, slung grease, or damage.
- If there is leakage, slung grease, or damage, before further flight, replacing the bearing with an airworthy bearing that does not have a black seal, which would be terminating action for the requirements of this AD.

Differences between this AD and the Service Information

The Bell ASBs specify 25 hours TIS for the initial inspection, while this AD requires inspecting within 10 hours TIS. The ASBs specify replacing any bearing with black seal material within 500 hours TIS or by December 31, 2013. This AD requires repetitive inspections of the bearing until the bearing is replaced with an airworthy bearing that does not have a black seal.

Interim Action

We consider this AD to be an interim action. We are currently considering requiring the replacement of the defective bearings, which will constitute terminating action for the repetitive inspections required by this AD action. However, the planned compliance time for the replacement of the bearing would allow enough time to provide notice and opportunity for prior public comment on the merits of the replacement.

Costs of Compliance

We estimate that this AD will affect 26 helicopters of U.S. Registry. We estimate that operators may incur the following costs in order to comply with this AD. At an average labor cost of \$85 per hour, inspecting the bearings would require about 2.5 work hours, for a cost per helicopter of \$213 and a cost of \$5,538 for the fleet. Replacing a defective bearing would require about 3 work hours, and required parts would cost

\$1,372 per bearing, for a cost per helicopter of \$1,627.

According to Bell's service information some of the costs of this AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage by Bell. Accordingly, we have included all costs in our cost estimate.

FAA's Justification and Determination of the Effective Date

Providing an opportunity for public comments prior to adopting these AD requirements would delay implementing the safety actions needed to correct this known unsafe condition. Therefore, we find that the risk to the flying public justifies waiving notice and comment prior to the adoption of this rule because the required corrective actions must be accomplished within 10 hours TIS, a very short time period based on the average flight hour utilization rate of these helicopters.

Since an unsafe condition exists that requires the immediate adoption of this AD, we determined that notice and opportunity for public comment before issuing this AD are impracticable and that good cause exists for making this amendment effective in less than 30 days.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress

charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed, I certify that this AD:

1. Is not a “significant regulatory action” under Executive Order 12866;
2. Is not a “significant rule” under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska to the extent that it justifies making a regulatory distinction; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared an economic evaluation of the estimated costs to comply with this AD and placed it in the AD docket.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by Reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39 - AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

2013-11-05 **BELL HELICOPTER TEXTRON, INC. (BELL)**: Amendment 39-17465; Docket No. FAA-2013-0470; Directorate Identifier 2013-SW-008-AD.

(a) Applicability.

This AD applies to Bell Model 214B helicopters, serial number (S/N) 28001 through 28070, Model 214B-1 helicopters, S/N 28001 through 28070, and Model 214ST helicopters, S/N 28101 through 28200, with a tail rotor hanger bearing (bearing), part number (P/N) 214-040-606-005 or 214-040-606-101 installed, certificated in any category.

(b) Unsafe Condition.

This AD defines the unsafe condition as a bearing with incorrect seal material, which could fail under extreme temperature or environmental conditions, resulting in loss of tail rotor control and subsequent loss of control of the helicopter.

(c) Effective Date.

This AD becomes effective [INSERT DATE 15 DAYS AFTER DATE OF

PUBLICATION IN THE FEDERAL REGISTER].

(d) Compliance.

You are responsible for performing each action required by this AD within the specified compliance time.

(e) Required Actions.

(1) Within 10 hours time in service (TIS):

(i) Inspect each bearing to determine whether the seal material is correct, as described in the Accomplishment Instructions, Part 1- Inspection, paragraphs 1.a. through 2. and Figure 1 of Bell Alert Service Bulletin (ASB) 214-13-74, Revision A, dated March 25, 2013, for Model 214B and 214B-1 helicopters and ASB 214ST-13-90, Revision A, dated March 25, 2013, for Model 214ST helicopters.

(ii) For each bearing with black seal material, before further flight and thereafter at intervals not to exceed 10 hours TIS, inspect the bearing for leakage, slung grease, or damage. If there is any leakage, slung grease, or damage, before further flight, replace the bearing with an airworthy bearing with red/orange to brown color seal material.

(2) Replacing a bearing with an airworthy bearing with the correct red/orange to brown color seal material terminates the inspection requirements of this AD.

(3) Do not install bearing P/N 214-040-606-005 or 214-040-606-101 with black seal material on any helicopter.

(f) Special flight permits.

Special flight permits are prohibited.

(g) Alternative Methods of Compliance (AMOCs).

(1) The Manager, Rotorcraft Certification Office, FAA, may approve AMOCs for

this AD. Send your proposal to: James Blyn, Aviation Safety Engineer, Rotorcraft Certification Office, Rotorcraft Directorate, FAA, 2601 Meacham Blvd., Fort Worth, Texas 76137; telephone (817) 222-5762; email 7-AVS-ASW-170@faa.gov.

(2) For operations conducted under a 14 CFR part 119 operating certificate or under 14 CFR part 91, subpart K, we suggest that you notify your principal inspector, or lacking a principal inspector, the manager of the local flight standards district office or certificate holding district office before operating any aircraft complying with this AD through an AMOC.

(h) Subject.

Joint Aircraft Service Component (JASC) Code: 6500: Tail Rotor Drive Bearing.

(i) Material Incorporated by Reference.

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Bell Alert Service Bulletin No. 214-13-74, Revision A, dated March 25, 2013.

(ii) Bell Alert Service Bulletin No. 214ST-13-90, Revision A, dated March 25, 2013.

(3) For Bell service information identified in this AD, contact Bell Helicopter Textron, Inc., P.O. Box 482, Fort Worth, TX 76101; telephone (817) 280-3391; fax (817) 280-6466; or at <http://www.bellcustomer.com/files/>.

(4) You may view this service information at FAA, Office of the Regional Counsel, Southwest Region, 2601 Meacham Blvd., Room 663, Fort Worth, Texas 76137. For information on the availability of this material at the FAA, call (817) 222-5110.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call (202) 741-6030, or go to:

<http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Fort Worth, Texas, on May 17, 2013.

Kim Smith,

Directorate Manager, Rotorcraft Directorate,
Aircraft Certification Service.

[FR Doc. 2013-12720 Filed 06/03/2013 at 8:45 am; Publication Date: 06/04/2013]